


# **Star-delta TIMER**

# Order Code

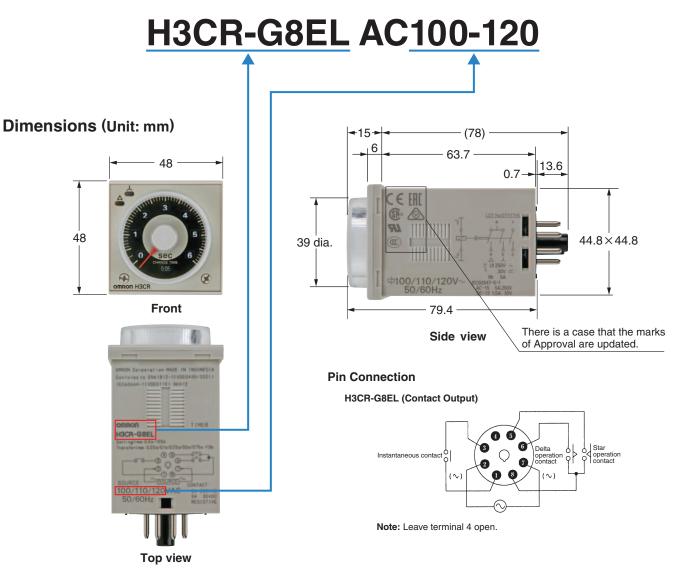

## **Technical criteria**

Rated supply voltage	100 to 120 VAC (50/60 Hz)		
Reset Power Off time	0.5 s min		
Operating Temperature	-10 to 55 °C		
Signal Input type			
Start Signal input time			
Output	Contact Output: Time limit contact, SPST-NO (Star-operation), SPST-NO (Delta-operation) Instantaneous contact, SPST-NO 5 A at 250 VAC/30 VDC, 0.15 A at 125 VDC, resistive load (cosφ = 1) Minimum applicable load: 10 mA at 5 VDC (failure level: P). Contact Material: Ag alloy		
Accuracy of Star-delta transfer time	±25% Full Scale + 5 ms or less		
Operating mode	Star-delta timer with instantaneous output		
Safety Standards	UL 508, CSA C22.2 No.14 CCC CE Marking under EN 61812-1, IEC 60664-1 Marine Approvals (NK, Lloyds) For the most recent information on models that have been certified for safety standards, refer to your OMRON website.		

#### Nomenclature

Star operation indicator: Green — Delta operation indicator: Orange —

Scale range display windows



Time unit display (sec is fixed)

Time setting knob (for setting star operation time)

Star-delta transfer time selector (select one from 0.05s, 0.1s, 0.25s, 0.5s, 0.75s, and 1.0s)

Star operation time range selector — (select one from 6, 12, 60, and 120 at full scale)


Star-delta transfer time display window

#### **Time range**

Time unit Scale number (max.)		Star operation time ranges	
6	Set time range	0.5 to 6 s	
12		1 to 12 s	
60		5 to 60 s	
120		10 to 120 s	

	Star-delta transfer time	Programmable at 0.05 s, 0.1 s, 0.25 s, 0.5 s, 0.75 s, or 1.0 s
		· · · · ·

## **Timing Chart**

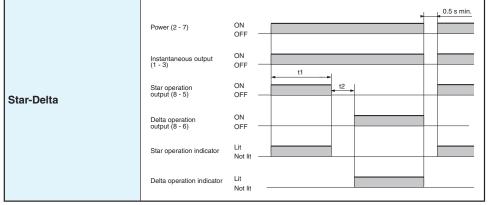

t1: Star operation time setting t2: Star-delta transfer time

#### Accessories

